




| POINT # | NORTHING   | EASTING    | DESCRIPTION               |
|---------|------------|------------|---------------------------|
| 600     | 1894960.83 | 1413038.58 | PCORI 2" AC - PLS 33864   |
| 617     | 1893947.09 | 1411458.50 | LCORI 3.25AC - PLS 32615  |
| 621     | 1894444.71 | 1411466.28 | LCORI 3.25AC - PLS 36812  |
| 684     | 1895462.31 | 1412774.12 | LCORI 3.25AC - PLS 36812  |
| 686     | 1895479.92 | 1414081.97 | LCORI 3.25AC - PLS 36812  |
| 691     | 1892857.54 | 1414107.71 | LCORI 3.25AC - PLS 36812  |
| 800     | 1894444.98 | 1413047.02 | PCORI 1.5" AC - PLS 31313 |
| 801     | 1894447.32 | 1413196.82 | PCORI 1" PC - BROKEN      |
| 814     | 1894446.62 | 1413146.87 | PCORI 1.5" AC - PLS 31313 |
| 815     | 1894445.76 | 1413097.04 | PCORI 1.5" AC - PLS 31313 |
| 817     | 1894513.73 | 1413271.90 | PCORI 2" AC - PLS 3300    |
| 820     | 1894438.44 | 1412631.18 | PCORI 2" AC - PLS 31319   |
| 822     | 1894404.59 | 1412756.74 | PCORI 2" AC - PLS 31319   |
| 823     | 1894296.44 | 1412758.52 | PCORI 2" AC - PLS 3364    |
| 824     | 1894344.19 | 1412757.73 | PCORI 2" AC - PLS 3364    |
| 829     | 1894634.66 | 1412624.86 | PCORI 1.5" AC - PLS 31319 |
| 830     | 1894635.86 | 1412749.99 | PCORI 1.5" AC - PLS 31319 |

| POINT # | NORTHING   | EASTING    | DESCRIPTION             |
|---------|------------|------------|-------------------------|
| 836     | 1894510.97 | 1413046.14 | PCORI 2" AC - PLS 36812 |
| 837     | 1894634.93 | 1413044.14 | PCORI 2" AC - PLS 36812 |
| 838     | 1894639.78 | 1413344.20 | PCORI 2" AC - PLS 36812 |
| 839     | 1894515.66 | 1413346.15 | PCORI 2" AC - PLS 36812 |
| 840     | 1894320.79 | 1413049.12 | PCORI 2" AC - PLS 36812 |
| 841     | 1894508.66 | 1412896.15 | PCORI 2" AC - PLS 36812 |
| 842     | 1894442.67 | 1412897.04 | PCORI 2" AC - PLS 36812 |
| 843     | 1894440.74 | 1412772.14 | PCORI 2" AC - PLS 36812 |
| 844     | 1894504.43 | 1412630.13 | PCORI 2" AC - PLS 3369  |
| 845     | 1894638.31 | 1412890.85 | PCORI 2" AC - PLS 36812 |
| 846     | 1894176.68 | 1412901.18 | PCORI 2" AC - PLS 36812 |
| 1004    | 1894440.50 | 1412756.14 | CS/PELS - 3139          |

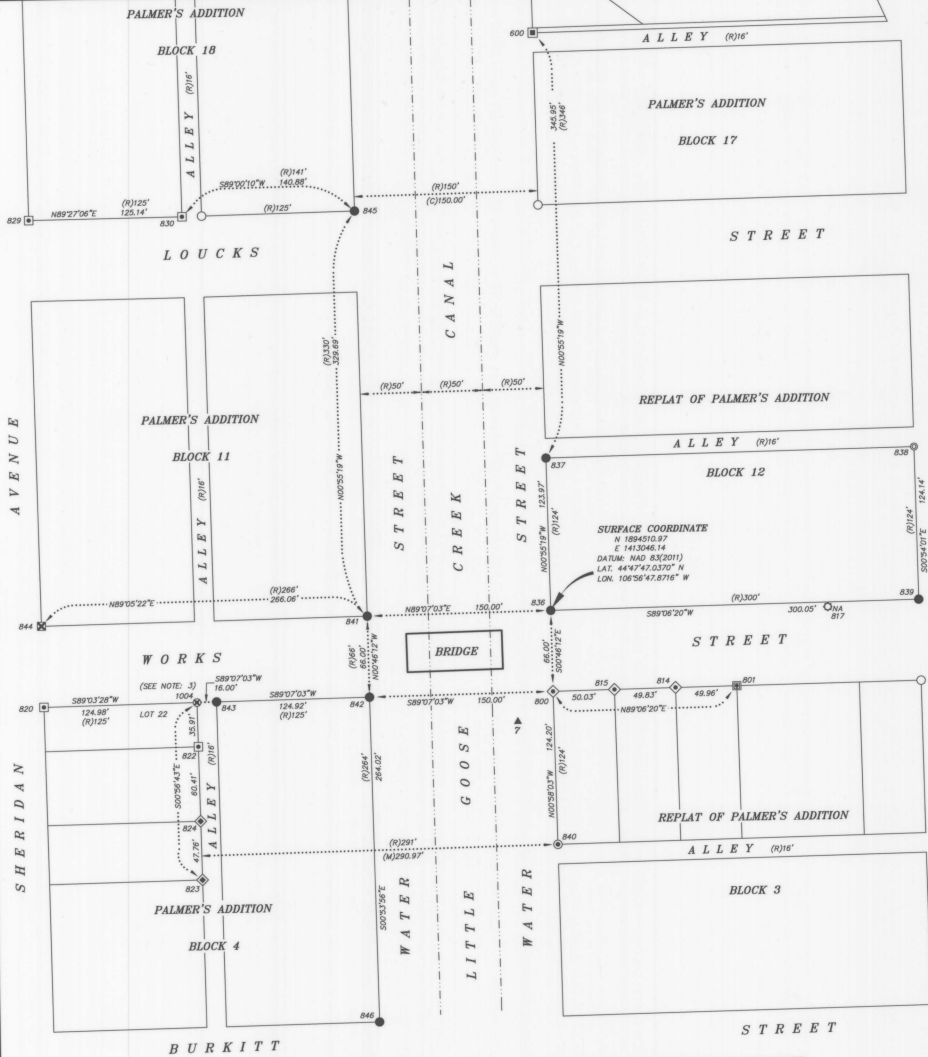


#### NOTES:

- 1) PALMER'S ADDITION TO SHERIDAN: "AS PALMER'S ADDITION TO SHERIDAN, THE STREETS AND ALLEYS AS THE SAME APPEAR ON THIS PLAT WERE DEDICATED TO THE USE OF THE PUBLIC". RECORDED AS PLAT P, PAGE 1, AUGUST 13, 1892.
- 2) REPLAT OF PALMER'S ADDITION TO SHERIDAN: "AS PALMER'S ADDITION TO SHERIDAN - REPLATED IN A.D. 1907, THE STREETS AND ALLEYS AS THE SAME APPEAR ON THIS PLAT WERE DEDICATED TO THE USE OF THE PUBLIC". RECORDED AS PLAT P, PAGE 2, JULY 25, 1907.
- 3) A MONUMENT COULD NOT BE ESTABLISHED AT THE NE CORNER OF LOT 22, BLOCK 4, PALMER'S ADDITION, THE CORNER FALLS "NEAR" THE CENTER OF AN EXISTING CURB STOP. THE MATHEMATICAL POSITION OF SAID NE CORNER WAS DETERMINED FROM SURVEY INFORMATION PROVIDED BY PEALS 3159.

#### LEGEND:

- SET 2" ALUMINUM CAP PER PLS 6812
- FOUND WYDOT CONTROL POINT
- ⊙ FOUND 3/8" REBAR - SET 2" ALUMINUM CAP PER PLS 6812
- ⊙ FOUND NAIL WITH WHISKER - SET 2" ALUMINUM CAP PER PLS 6812
- ⊙ FOUND 2" ALUMINUM CAP PER PEALS 3864
- ⊙ FOUND 1-1/2" ALUMINUM CAP PER PLS 13153
- ⊙ FOUND 2" ALUMINUM CAP PER PLS 3300
- ⊙ FOUND 1-1/2" OR 2" ALUMINUM CAP PER PEALS 3159
- ⊙ FOUND 2" ALUMINUM CAP PER PEALS 4364
- ⊙ FOUND 2" ALUMINUM CAP PER PLS 5369
- ⊙ FOUND 3/8" REBAR WITH BROKE PLASTIC CAP
- ⊙ FOUND CURB STOP - POSITION ACCEPTED BY PEALS 3159
- ⊙ FOUND 3-1/4" ALUMINUM CAP PER PLS 6812
- ⊙ FOUND 3-1/4" ALUMINUM CAP PER PLS 2615
- CALCULATED NOTHING FOUND/NOTHING SET
- RECORD
- (M) MEASURED
- (C) CALCULATED
- NA NOT ACCEPTED
- LOT/BLK LINE
- SECTION LINE
- INTERIOR SECTION LINE
- LITTLE GOOSE CREEK CANAL

NOTICE: This plat is a map or representation of the original as it is recorded in the public records of the State of Wyoming. It is not a survey, nor does it contain any measurements, or representations of the original as it is recorded in the public records of the State of Wyoming.

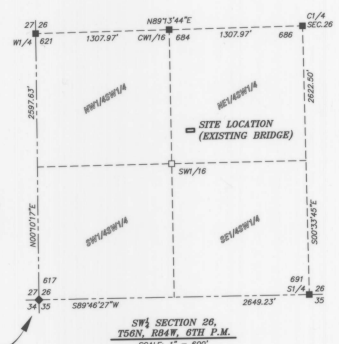

SURFACE COORDINATE  
N 1892847.09  
E 1411458.50  
DATUM: NAD 83(2011)  
LAT. 44°57'30.684" N  
LON. 106°57'09.992" W

#### CERTIFICATE OF RECORDER

STATE OF WYOMING  
COUNTY OF SHERIDAN  
THIS PLAT WAS FILED FOR RECORD IN THE OFFICE OF THE CLERK AND RECORDER AT 10:22 O'CLOCK A.M.,  
THIS 16th DAY OF November, 2022, AND IS DULY RECORDED AS SURVEY A, NO. 682  
FEE \$128.00  
Linkey Heinrich Deputy  
COUNTY CLERK  
STAMP RECEIVING NUMBER 2022-782635



#### CONTROL POINTS

| NO | NORTHING   | EASTING    | ELEV.   | DESCRIPTION  |
|----|------------|------------|---------|--------------|
| 5  | 1894446.30 | 1412184.84 | 3746.64 | PCPI SHEAF 9 |
| 6  | 1894496.20 | 1412528.61 | 3745.83 | PCPI SHEAF 6 |
| 7  | 1894421.31 | 1413017.88 | 3751.05 | PCPI SHEAF 7 |
| 8  | 1894463.26 | 1413412.96 | 3750.32 | PCPI SHEAF 8 |
| 9  | 1894511.03 | 1413780.87 | 3757.91 | PCPI SHEAF 9 |

#### SURVEYOR'S CERTIFICATE

STATE OF WYOMING  
COUNTY OF SHERIDAN  
I, THOMAS D. TUCKER, A DULY REGISTERED LAND SURVEYOR IN THE STATE OF WYOMING, DO HEREBY STATE THAT THIS PLAT REPRESENTS THE RESULTS OF A SURVEY MADE BY ME OR UNDER MY DIRECT SUPERVISION.



#### RECORD OF SURVEY

WYDOT PROJECT NUMBER: 2550501  
INTERSECTION OF WORKS STREET & WATER STREETS  
LOCATION: BLOCK 4 & 11, PALMER'S ADDITION AND BLOCK 3 & 12, REPLAT OF PALMER'S ADDITION, SITUATED IN THE SW 1/4 OF SECTION 26, TOWNSHIP 56 NORTH, RANGE 84 WEST, 6TH PRINCIPAL MERIDIAN, CITY OF SHERIDAN, WYOMING

CLIENT: WYOMING DEPARTMENT OF TRANSPORTATION  
AT&T ENGINEERING SERVICES  
3300 BISHOP BOULEVARD  
CHEYENNE, WY 82009-3340  
B. RESTFELDT  
SURVEYING  
2340 WELANDS DR., SUITE 100  
PO BOX 3082  
SHERIDAN, WY 82801  
307-672-7415

JN 2022-043 S-2  
DL 2022-043 WYDOT  
TAB: 602-WYDOT  
PT 12022-043 &  
12022-043-WYDOT  
REVIEWED BY: JSP & CT  
NOVEMBER 15, 2022

#682